## SIEMENS

## Data sheet

## US2:18HUG82WE



Non-reversing motor starter, Size 3, Three phase full voltage, Solid-state overload relay, OLR amp range 25-100A, Combination type, 125A circuit breaker, Encl NEMA type 4X 304 S-Steel, Water/dust tight noncorrosive, Extra-wide enclosure

product brand name	Class 18 & 26
design of the product	Full-voltage non-reversing motor starter with motor circuit protector
special product feature	ESP200 overload relay
General technical data	
Height x Width x Depth [in]	36 × 24 × 8 in
touch protection against electrical shock	NA for enclosed products
installation altitude [ft] at height above sea level maximum	6560 ft
ambient temperature [°F]	
during storage	-22 +149 °F
during operation	-4 +104 °F
ambient temperature	
during storage	-30 +65 °C
during operation	-20 +40 °C
Horsepower ratings	
yielded mechanical performance [hp] for 3-phase AC motor	
• at 200/208 V rated value	25 hp
• at 220/230 V rated value	30 hp
• at 460/480 V rated value	50 hp
• at 575/600 V rated value	50 hp
Contactor	
size of contactor	NEMA controller size 3
number of NO contacts for main contacts	3
operating voltage for main current circuit at AC at 60 Hz maximum	600 V
operational current at AC at 600 V rated value	90 A
mechanical service life (operating cycles) of the main contacts typical	500000
Auxiliary contact	
number of NC contacts at contactor for auxiliary contacts	0
number of NO contacts at contactor for auxiliary contacts	1
number of total auxiliary contacts maximum	7
contact rating of auxiliary contacts of contactor according to UL	10A@600VAC (A600), 5A@600VDC (P600)
Coil	
type of voltage of the control supply voltage	AC
control supply voltage	
• at AC at 50 Hz rated value	550 V
• at AC at 60 Hz rated value	575 600 V
holding power at AC minimum	14 W
apparent pick-up power of magnet coil at AC	310 VA
apparent holding power of magnet coil at AC	26 VA
operating range factor control supply voltage rated value of	0.85 1.1

magnet coil	50 %
percental drop-out voltage of magnet coil related to the input voltage	00 /0
ON-delay time	26 41 ms
OFF-delay time	14 19 ms
Overload relay	
reset function	Manual, automatic and remote
trip class	CLASS 5 / 10 / 20 (factory set) / 30
adjustable current response value current of the current- dependent overload release	25 100 A
make time with automatic start after power failure maximum	3 s
relative repeat accuracy	1 %
number of NC contacts of auxiliary contacts of overload relay	1
number of NO contacts of auxiliary contacts of overload relay	1
operational current of auxiliary contacts of overload relay	
• at AC at 600 V	5 A
• at DC at 250 V	1 A
contact rating of auxiliary contacts of overload relay according to UL	5A@600VAC (B600), 1A@250VDC (R300)
insulation voltage (Ui)	0001/
with single-phase operation at AC rated value	600 V
with multi-phase operation at AC rated value	300 V
Enclosure	
degree of protection NEMA rating	4X, 304 stainless steel
design of the housing	dustproof, waterproof & resistant to corrosion
Circuit Breaker	
type of the motor protection	Motor circuit protector (magnetic trip only)
operational current of motor circuit breaker rated value	125 A
adjustable current response value current of instantaneous short-circuit trip unit	500 1250 A
Mounting/wiring	
mounting position	Vertical
mounting position fastening method	Surface mounting and installation
mounting position fastening method type of electrical connection for supply voltage line-side	Surface mounting and installation Box lug
mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG)
mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C
mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU
mounting position     fastening method     type of electrical connection for supply voltage line-side     type of connectable conductor cross-sections at line-side for     AWG cables single or multi-stranded     temperature of the conductor for supply maximum permissible     material of the conductor for supply     type of electrical connection for load-side outgoing feeder	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug
mounting position     fastening method     type of electrical connection for supply voltage line-side     type of connectable conductor cross-sections at line-side for     AWG cables single or multi-stranded     temperature of the conductor for supply maximum permissible     material of the conductor for supply     type of electrical connection for load-side outgoing feeder     tightening torque [lbf-in] for load-side outgoing feeder	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in
mounting position     fastening method     type of electrical connection for supply voltage line-side     type of connectable conductor cross-sections at line-side for     AWG cables single or multi-stranded     temperature of the conductor for supply maximum permissible     material of the conductor for supply     type of electrical connection for load-side outgoing feeder     tightening torque [lbf-in] for load-side outgoing feeder     type of connectable conductor cross-sections for AWG cables     for load-side outgoing feeder single or multi-stranded	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf·in 1x (14 2/0 AWG)
mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf·in 1x (14 2/0 AWG) 75 °C
mounting position     fastening method     type of electrical connection for supply voltage line-side     type of connectable conductor cross-sections at line-side for     AWG cables single or multi-stranded     temperature of the conductor for supply maximum permissible     material of the conductor for supply     type of electrical connection for load-side outgoing feeder     tightening torque [lbf-in] for load-side outgoing feeder     type of connectable conductor cross-sections for AWG cables     for load-side outgoing feeder single or multi-stranded     temperature of the conductor for load-side outgoing feeder     maximum permissible     material of the conductor for load-side outgoing feeder	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU
mounting position     fastening method     type of electrical connection for supply voltage line-side     type of connectable conductor cross-sections at line-side for     AWG cables single or multi-stranded     temperature of the conductor for supply maximum permissible     material of the conductor for supply     type of electrical connection for load-side outgoing feeder     tightening torque [lbf-in] for load-side outgoing feeder     type of connectable conductor cross-sections for AWG cables     for load-side outgoing feeder single or multi-stranded     temperature of the conductor for load-side outgoing feeder     type of connectable conductor for load-side outgoing feeder     type of connectable conductor for load-side outgoing feeder     material of the conductor for load-side outgoing feeder     maximum permissible     material of the conductor for load-side outgoing feeder     type of electrical connection of magnet coil	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals
mounting position     fastening method     type of electrical connection for supply voltage line-side     type of connectable conductor cross-sections at line-side for     AWG cables single or multi-stranded     temperature of the conductor for supply maximum permissible     material of the conductor for supply     type of electrical connection for load-side outgoing feeder     tightening torque [lbf-in] for load-side outgoing feeder     type of connectable conductor cross-sections for AWG cables     for load-side outgoing feeder single or multi-stranded     temperature of the conductor for load-side outgoing feeder     type of cleatrical connection for load-side outgoing feeder     type of connectable conductor cross-sections for AWG cables     for load-side outgoing feeder single or multi-stranded     temperature of the conductor for load-side outgoing feeder     maximum permissible     material of the conductor for load-side outgoing feeder     type of electrical connection of magnet coil     tightening torque [lbf-in] at magnet coil     type of connectable conductor cross-sections of magnet coil for	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU
mounting position     fastening method     type of electrical connection for supply voltage line-side     type of connectable conductor cross-sections at line-side for     AWG cables single or multi-stranded     temperature of the conductor for supply maximum permissible     material of the conductor for supply     type of electrical connection for load-side outgoing feeder     tightening torque [lbf-in] for load-side outgoing feeder     type of connectable conductor cross-sections for AWG cables     for load-side outgoing feeder     type of connectable conductor for load-side outgoing feeder     type of connectable conductor for load-side outgoing feeder     type of load-side outgoing feeder single or multi-stranded     temperature of the conductor for load-side outgoing feeder     maximum permissible     material of the conductor for load-side outgoing feeder     type of electrical connection of magnet coil     tightening torque [lbf-in] at magnet coil     type of connectable conductor cross-sections of magnet coil for     AWG cables single or multi-stranded     temperature of the conductor at magnet coil maximum	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf-in
mounting position     fastening method     type of electrical connection for supply voltage line-side     type of connectable conductor cross-sections at line-side for     AWG cables single or multi-stranded     temperature of the conductor for supply maximum permissible     material of the conductor for supply     type of electrical connection for load-side outgoing feeder     tightening torque [lbf-in] for load-side outgoing feeder     type of connectable conductor cross-sections for AWG cables     for load-side outgoing feeder single or multi-stranded     temperature of the conductor for load-side outgoing feeder     material of the conductor for load-side outgoing feeder     maximum permissible     material of the conductor for load-side outgoing feeder     type of electrical connection of magnet coil     tightening torque [lbf-in] at magnet coil     type of connectable conductor cross-sections of magnet coil for     AWG cables single or multi-stranded     temperature of the conductor at magnet coil maximum     permissible	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG) 75 °C
mounting position     fastening method     type of electrical connection for supply voltage line-side     type of connectable conductor cross-sections at line-side for     AWG cables single or multi-stranded     temperature of the conductor for supply maximum permissible     material of the conductor for supply     type of electrical connection for load-side outgoing feeder     tightening torque [lbf-in] for load-side outgoing feeder     type of connectable conductor cross-sections for AWG cables     for load-side outgoing feeder single or multi-stranded     temperature of the conductor for load-side outgoing feeder     maximum permissible     material of the conductor for load-side outgoing feeder     type of electrical connection of magnet coil     tightening torque [lbf-in] at magnet coil     type of connectable conductor cross-sections of magnet coil for     AWG cables single or multi-stranded     temperature of the conductor at magnet coil maximum     permissible	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf·in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf·in 2x (16 12 AWG) 75 °C
mounting position     fastening method     type of electrical connection for supply voltage line-side     type of connectable conductor cross-sections at line-side for     AWG cables single or multi-stranded     temperature of the conductor for supply maximum permissible     material of the conductor for supply     type of electrical connection for load-side outgoing feeder     tightening torque [lbf-in] for load-side outgoing feeder     type of connectable conductor rorss-sections for AWG cables     for load-side outgoing feeder single or multi-stranded     temperature of the conductor for load-side outgoing feeder     maximum permissible     material of the conductor for load-side outgoing feeder     type of electrical connection of magnet coil     tightening torque [lbf-in] at magnet coil     type of connectable conductor cross-sections of magnet coil for     AWG cables single or multi-stranded     temperature of the conductor at magnet coil maximum     permissible     material of the conductor at magnet coil     type of electrical connection of ro auxiliary contacts	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf·in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf·in 2x (16 12 AWG) 75 °C CU Screw-type terminals
mounting position     fastening method     type of electrical connection for supply voltage line-side     type of connectable conductor cross-sections at line-side for     AWG cables single or multi-stranded     temperature of the conductor for supply maximum permissible     material of the conductor for supply     type of electrical connection for load-side outgoing feeder     tightening torque [lbf-in] for load-side outgoing feeder     type of connectable conductor cross-sections for AWG cables     for load-side outgoing feeder single or multi-stranded     temperature of the conductor for load-side outgoing feeder     maximum permissible     material of the conductor for load-side outgoing feeder     maximum permissible     material of the conductor for load-side outgoing feeder     type of electrical connection of magnet coil     tightening torque [lbf-in] at magnet coil     type of connectable conductor cross-sections of magnet coil for     AWG cables single or multi-stranded     temperature of the conductor at magnet coil maximum     permissible     material of the conductor at magnet coil     type of electrical connection for auxiliary contacts     tightening torque [lbf-in] at contactor for auxiliary contacts     type of electrical connec	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf·in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf·in 2x (16 12 AWG) 75 °C
mounting position     fastening method     type of electrical connection for supply voltage line-side     type of connectable conductor cross-sections at line-side for     AWG cables single or multi-stranded     temperature of the conductor for supply maximum permissible     material of the conductor for supply     type of electrical connection for load-side outgoing feeder     tightening torque [lbf-in] for load-side outgoing feeder     type of connectable conductor cross-sections for AWG cables     for load-side outgoing feeder single or multi-stranded     temperature of the conductor for load-side outgoing feeder     maximum permissible     material of the conductor for load-side outgoing feeder     type of electrical connection of magnet coil     tightening torque [lbf-in] at magnet coil     type of connectable conductor at magnet coil maximum     permissible     material of the conductor at magnet coil     type of electrical connection for auxiliary contacts     tightening torque [lbf-in] at contactor for auxiliary contacts     type of electrical connection for auxiliary contacts <tr< td=""><td>Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG) 75 °C CU Screw-type terminals 10 15 lbf-in</td></tr<>	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG) 75 °C CU Screw-type terminals 10 15 lbf-in
mounting position     fastening method     type of electrical connection for supply voltage line-side     type of connectable conductor cross-sections at line-side for     AWG cables single or multi-stranded     temperature of the conductor for supply maximum permissible     material of the conductor for supply     type of electrical connection for load-side outgoing feeder     tightening torque [lbf-in] for load-side outgoing feeder     type of connectable conductor cross-sections for AWG cables     for load-side outgoing feeder single or multi-stranded     temperature of the conductor for load-side outgoing feeder     maximum permissible     material of the conductor for load-side outgoing feeder     type of electrical connection of magnet coil     tightening torque [lbf-in] at magnet coil     tightening torque [lbf-in] at magnet coil     type of cables single or multi-stranded     temperature of the conductor at magnet coil maximum     permissible     material of the conductor at magnet coil     tightening torque [lbf-in] at contactor for auxiliary contacts	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf·in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf·in 2x (16 12 AWG) 75 °C CU Screw-type terminals 10 15 lbf·in 1x (12 AWG), 2x (16 14 AWG), 2x (18 16 AWG)
mounting position     fastening method     type of electrical connection for supply voltage line-side     type of connectable conductor cross-sections at line-side for     AWG cables single or multi-stranded     temperature of the conductor for supply maximum permissible     material of the conductor for supply     type of electrical connection for load-side outgoing feeder     tightening torque [lbf-in] for load-side outgoing feeder     type of connectable conductor cross-sections for AWG cables     for load-side outgoing feeder single or multi-stranded     temperature of the conductor for load-side outgoing feeder     maximum permissible     material of the conductor for load-side outgoing feeder     type of electrical connection of magnet coil     tightening torque [lbf-in] at magnet coil     type of connectable conductor at magnet coil maximum     permissible     material of the conductor at magnet coil     type of electrical connection for auxiliary contacts     tightening torque [lbf-in] at contactor for auxiliary contacts     type of electrical connection for auxiliary contacts <tr< td=""><td>Surface mounting and installation     Box lug     1x (10 AWG 1/0 AWG)     75 °C     AL or CU     Box lug     120 120 lbf-in     1x (14 2/0 AWG)     75 °C     AL or CU     Screw-type terminals     5 12 lbf-in     2x (16 12 AWG)     75 °C     CU     Screw-type terminals     10 12 AWG)     75 °C     CU     Screw-type terminals     10 12 AWG)     75 °C     CU     Screw-type terminals     10 15 lbf-in     1x (12 AWG), 2x (16 14 AWG), 2x (18 16 AWG)     75 °C</td></tr<>	Surface mounting and installation     Box lug     1x (10 AWG 1/0 AWG)     75 °C     AL or CU     Box lug     120 120 lbf-in     1x (14 2/0 AWG)     75 °C     AL or CU     Screw-type terminals     5 12 lbf-in     2x (16 12 AWG)     75 °C     CU     Screw-type terminals     10 12 AWG)     75 °C     CU     Screw-type terminals     10 12 AWG)     75 °C     CU     Screw-type terminals     10 15 lbf-in     1x (12 AWG), 2x (16 14 AWG), 2x (18 16 AWG)     75 °C
mounting positionfastening methodtype of electrical connection for supply voltage line-sidetype of connectable conductor cross-sections at line-side for AWG cables single or multi-strandedtemperature of the conductor for supply maximum permissiblematerial of the conductor for supplytype of electrical connection for load-side outgoing feedertightening torque [lbf-in] for load-side outgoing feedertype of connectable conductor for supplytype of connectable conductor for load-side outgoing feedertype of connectable conductor for load-side outgoing feedermaximum permissiblematerial of the conductor for load-side outgoing feedermaximum permissiblematerial of the conductor for load-side outgoing feedertype of electrical connection of magnet coiltightening torque [lbf-in] at magnet coiltype of connectable conductor at magnet coil maximum permissiblematerial of the conductor at magnet coil maximum permissiblematerial of the conductor at magnet coiltype of electrical connection for auxiliary contactstightening torque [lbf-in] at contactor for auxiliary contactstightening torque [lbf-in] at contactor for auxiliary contactstype of connectable conductor at magnet coiltype of connectable conductor cross-sections at contactor forAWG cables for auxiliary contactstightening torque [lbf-in] at contactor for auxiliary contactstype of connectable conductor at contactor for auxiliary contactstype of connectable conductor at contactor for auxiliary contactstype of electrical connection for aux	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG) 75 °C CU Screw-type terminals 10 15 lbf-in 1x (12 AWG), 2x (16 14 AWG), 2x (18 16 AWG) 75 °C CU
mounting position     fastening method     type of electrical connection for supply voltage line-side     type of connectable conductor cross-sections at line-side for     AWG cables single or multi-stranded     temperature of the conductor for supply maximum permissible     material of the conductor for supply     type of electrical connection for load-side outgoing feeder     tightening torque [lbf-in] for load-side outgoing feeder     type of connectable conductor cross-sections for AWG cables     for load-side outgoing feeder single or multi-stranded     temperature of the conductor for load-side outgoing feeder     maximum permissible     material of the conductor for load-side outgoing feeder     type of electrical connection of magnet coil     type of connectable conductor cross-sections of magnet coil for     AWG cables single or multi-stranded     temperature of the conductor at magnet coil     type of connectable conductor at magnet coil maximum     permissible     material of the conductor at magnet coil     type of electrical connection for auxiliary contacts     tightening torque [lbf-in] at contactor for auxiliary contacts     type of electrical connection for auxiliary contacts     type of connectable conductor cross-sections at contactor for	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG) 75 °C CU Screw-type terminals 10 15 lbf-in 1x (12 AWG), 2x (16 14 AWG), 2x (18 16 AWG) 75 °C CU Screw-type terminals

temperature of the conductor at overload relay for auxiliary contacts maximum permissible	75 °C
material of the conductor at overload relay for auxiliary contacts	CU
Short-circuit current rating	
design of the short-circuit trip	Instantaneous trip circuit breaker
maximum short-circuit current breaking capacity (Icu)	
• at 240 V	100 kA
• at 480 V	100 kA
• at 600 V	25 kA
certificate of suitability	NEMA ICS 2; UL 508; CSA 22.2, No.14

Further information

Industrial Controls - Product Overview (Catalogs, Brochures,...)

www.usa.siemens.com/iccatalog

Industry Mall (Online ordering system)


https://mall.industry.siemens.com/mall/en/us/Catalog/product?mlfb=US2:18HUG82WE


Service&Support (Manuals, Certificates, Characteristics, FAQs,...) https://support.industry.siemens.com/cs/US/en/ps/US2:18HUG82WE

Image database (product images, 2D dimension drawings, 3D models, device circuit diagrams, EPLAN macros, ...) http://www.automation.siemens.com/bilddb/cax\_de.aspx?mlfb=US2:18HUG82WE&lang=en

Certificates/approvals

https://support.industry.siemens.com/cs/US/en/ps/US2:18HUG82WE/certificate

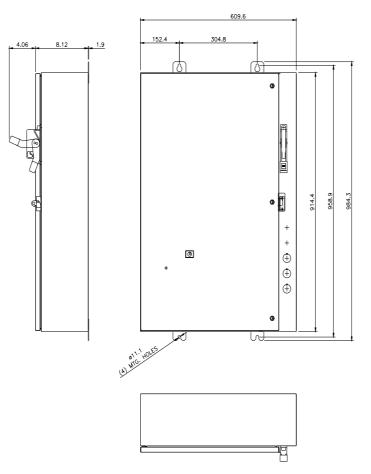

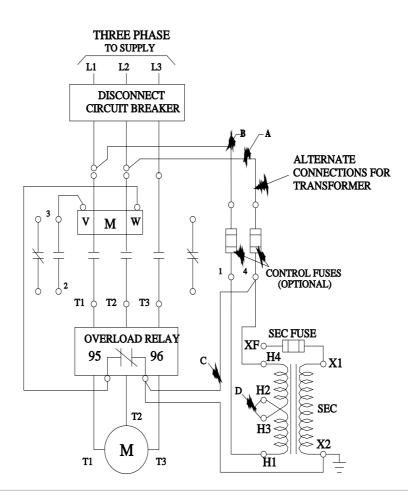

last modified:

1/25/2022 🖸