SIEMENS

Data sheet US2:18HUG82WJ



Non-reversing motor starter, Size 3, Three phase full voltage, Solid-state overload relay, OLR amp range 25-100A, 24VAC 50-60Hz coil, Combination type, 125A circuit breaker, Encl NEMA type 4X 304 S-Steel, Water/dust tight noncorrosive, Extra-wide enclosure

| product brand name | Class 18 & 26 |
|---|---|
| design of the product | Full-voltage non-reversing motor starter with motor circuit protector |
| special product feature | ESP200 overload relay |
| General technical data | |
| Height x Width x Depth [in] | 36 × 24 × 8 in |
| touch protection against electrical shock | NA for enclosed products |
| installation altitude [ft] at height above sea level maximum | 6560 ft |
| ambient temperature [°F] | |
| during storage | -22 +149 °F |
| during operation | -4 +104 °F |
| ambient temperature | |
| during storage | -30 +65 °C |
| during operation | -20 +40 °C |
| Horsepower ratings | |
| yielded mechanical performance [hp] for 3-phase AC motor | |
| • at 200/208 V rated value | 25 hp |
| • at 220/230 V rated value | 30 hp |
| • at 460/480 V rated value | 50 hp |
| ● at 575/600 V rated value | 50 hp |
| Contactor | |
| size of contactor | NEMA controller size 3 |
| number of NO contacts for main contacts | 3 |
| operating voltage for main current circuit at AC at 60 Hz maximum | 600 V |
| operational current at AC at 600 V rated value | 90 A |
| mechanical service life (operating cycles) of the main contacts typical | 5000000 |
| Auxiliary contact | |
| number of NC contacts at contactor for auxiliary contacts | 0 |
| number of NO contacts at contactor for auxiliary contacts | 1 |
| number of total auxiliary contacts maximum | 7 |
| contact rating of auxiliary contacts of contactor according to UL | 10A@600VAC (A600), 5A@600VDC (P600) |
| Coil | |
| type of voltage of the control supply voltage | AC |
| control supply voltage | |
| at AC at 50 Hz rated value | 24 V |
| at AC at 60 Hz rated value | 24 V |
| holding power at AC minimum | 14 W |
| apparent pick-up power of magnet coil at AC | 310 VA |
| apparent holding power of magnet coil at AC | 26 VA |
| operating range factor control supply voltage rated value of | 0.85 1.1 |

| magnet coil | |
|---|---|
| percental drop-out voltage of magnet coil related to the input voltage | 50 % |
| ON-delay time | 26 41 ms |
| OFF-delay time | 14 19 ms |
| Overload relay | |
| reset function | Manual, automatic and remote |
| trip class | CLASS 5 / 10 / 20 (factory set) / 30 |
| adjustable current response value current of the current- dependent overload release | 25 100 A |
| make time with automatic start after power failure maximum | 3 s |
| relative repeat accuracy | 1 % |
| number of NC contacts of auxiliary contacts of overload relay | 1 |
| number of NO contacts of auxiliary contacts of overload relay | 1 |
| operational current of auxiliary contacts of overload relay | |
| • at AC at 600 V | 5 A |
| • at DC at 250 V | 1 A |
| contact rating of auxiliary contacts of overload relay according to UL | 5A@600VAC (B600), 1A@250VDC (R300) |
| insulation voltage (Ui) | |
| with single-phase operation at AC rated value | 600 V |
| with multi-phase operation at AC rated value | 300 V |
| Enclosure | |
| degree of protection NEMA rating | 4X, 304 stainless steel |
| design of the housing | dustproof, waterproof & resistant to corrosion |
| Circuit Breaker | |
| type of the motor protection | Motor circuit protector (magnetic trip only) |
| operational current of motor circuit breaker rated value | 125 A |
| adjustable current response value current of instantaneous short-circuit trip unit | 500 1250 A |
| Mounting/wiring | |
| Mounting/wiring | |
| mounting position | Vertical |
| | Vertical Surface mounting and installation |
| mounting position fastening method type of electrical connection for supply voltage line-side | Surface mounting and installation Box lug |
| mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded | Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) |
| mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible | Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C |
| mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded | Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU |
| mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible | Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug |
| mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder | Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf·in |
| mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder | Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf·in 1x (14 2/0 AWG) |
| mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible | Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf·in 1x (14 2/0 AWG) 75 °C |
| mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible material of the conductor for load-side outgoing feeder | Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU |
| mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible material of the conductor for load-side outgoing feeder type of electrical connection of magnet coil | Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals |
| mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible material of the conductor for load-side outgoing feeder type of electrical connection of magnet coil tightening torque [lbf-in] at magnet coil | Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf-in |
| mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible material of the conductor for load-side outgoing feeder type of electrical connection of magnet coil | Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG) |
| mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible material of the conductor for load-side outgoing feeder type of electrical connection of magnet coil tightening torque [lbf-in] at magnet coil type of connectable conductor cross-sections of magnet coil for AWG cables single or multi-stranded temperature of the conductor at magnet coil maximum permissible | Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG) |
| mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible material of the conductor for load-side outgoing feeder type of electrical connection of magnet coil tightening torque [lbf-in] at magnet coil type of connectable conductor cross-sections of magnet coil for AWG cables single or multi-stranded temperature of the conductor at magnet coil maximum permissible material of the conductor at magnet coil | Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG) 75 °C CU |
| mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible material of the conductor for load-side outgoing feeder type of electrical connection of magnet coil tightening torque [lbf-in] at magnet coil type of connectable conductor cross-sections of magnet coil for AWG cables single or multi-stranded temperature of the conductor at magnet coil maximum permissible material of the conductor at magnet coil maximum permissible | Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG) 75 °C CU Screw-type terminals |
| mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible material of the conductor for load-side outgoing feeder type of electrical connection of magnet coil tightening torque [lbf-in] at magnet coil type of connectable conductor cross-sections of magnet coil for AWG cables single or multi-stranded temperature of the conductor at magnet coil maximum permissible material of the conductor at magnet coil maximum permissible | Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG) 75 °C CU Screw-type terminals 10 15 lbf-in |
| mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible material of the conductor for load-side outgoing feeder type of electrical connection of magnet coil tightening torque [lbf-in] at magnet coil type of connectable conductor cross-sections of magnet coil for AWG cables single or multi-stranded temperature of the conductor at magnet coil maximum permissible material of the conductor at magnet coil type of electrical connection for auxiliary contacts tightening torque [lbf-in] at contactor for auxiliary contacts tightening torque [lbf-in] at contactor for auxiliary contacts | Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG) 75 °C CU Screw-type terminals 10 15 lbf-in 1x (12 AWG), 2x (16 14 AWG), 2x (18 16 AWG) |
| mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible material of the conductor for load-side outgoing feeder type of electrical connection of magnet coil tightening torque [lbf-in] at magnet coil type of connectable conductor cross-sections of magnet coil for AWG cables single or multi-stranded temperature of the conductor at magnet coil maximum permissible material of the conductor at magnet coil type of electrical connection for auxiliary contacts tightening torque [lbf-in] at contactor for auxiliary contacts tightening torque [lbf-in] at contactor for auxiliary contacts type of connectable conductor cross-sections at contactor for AWG cables for auxiliary contacts single or multi-stranded temperature of the conductor at contactor for auxiliary contacts maximum permissible | Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG) 75 °C CU Screw-type terminals 10 15 lbf-in 1x (12 AWG), 2x (16 14 AWG), 2x (18 16 AWG) 75 °C |
| mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible material of the conductor for load-side outgoing feeder type of electrical connection of magnet coil tightening torque [lbf-in] at magnet coil type of connectable conductor cross-sections of magnet coil for AWG cables single or multi-stranded temperature of the conductor at magnet coil maximum permissible material of the conductor at magnet coil type of electrical connection for auxiliary contacts tightening torque [lbf-in] at contactor for auxiliary contacts type of connectable conductor cross-sections at contactor for AWG cables for auxiliary contacts single or multi-stranded temperature of the conductor at contactor for auxiliary contacts maximum permissible material of the conductor at contactor for auxiliary contacts maximum permissible material of the conductor at contactor for auxiliary contacts maximum permissible | Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG) 75 °C CU Screw-type terminals 10 15 lbf-in 1x (12 AWG), 2x (16 14 AWG), 2x (18 16 AWG) 75 °C CU |
| mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible material of the conductor for load-side outgoing feeder type of electrical connection of magnet coil tightening torque [lbf-in] at magnet coil type of connectable conductor cross-sections of magnet coil for AWG cables single or multi-stranded temperature of the conductor at magnet coil maximum permissible material of the conductor at magnet coil type of electrical connection for auxiliary contacts tightening torque [lbf-in] at contactor for auxiliary contacts type of connectable conductor cross-sections at contactor for AWG cables for auxiliary contacts single or multi-stranded temperature of the conductor at contactor for auxiliary contacts maximum permissible material of the conductor at contactor for auxiliary contacts type of electrical connection at overload relay for auxiliary contacts | Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG) 75 °C CU Screw-type terminals 10 15 lbf-in 1x (12 AWG), 2x (16 14 AWG), 2x (18 16 AWG) 75 °C CU Screw-type terminals |
| mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible material of the conductor for load-side outgoing feeder type of electrical connection of magnet coil tightening torque [lbf-in] at magnet coil type of connectable conductor cross-sections of magnet coil for AWG cables single or multi-stranded temperature of the conductor at magnet coil maximum permissible material of the conductor at magnet coil type of electrical connection for auxiliary contacts tightening torque [lbf-in] at contactor for auxiliary contacts type of connectable conductor cross-sections at contactor for AWG cables for auxiliary contacts single or multi-stranded temperature of the conductor at contactor for auxiliary contacts maximum permissible material of the conductor at contactor for auxiliary contacts maximum permissible material of the conductor at contactor for auxiliary contacts maximum permissible | Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG) 75 °C CU Screw-type terminals 10 15 lbf-in 1x (12 AWG), 2x (16 14 AWG), 2x (18 16 AWG) 75 °C CU |

| temperature of the conductor at overload relay for auxiliary contacts maximum permissible | 75 °C |
|---|-------------------------------------|
| material of the conductor at overload relay for auxiliary contacts | CU |
| Short-circuit current rating | |
| design of the short-circuit trip | Instantaneous trip circuit breaker |
| maximum short-circuit current breaking capacity (Icu) | |
| • at 240 V | 100 kA |
| • at 480 V | 100 kA |
| • at 600 V | 25 kA |
| certificate of suitability | NEMA ICS 2; UL 508; CSA 22.2, No.14 |
| Further information | |

Industrial Controls - Product Overview (Catalogs, Brochures,...)

www.usa.siemens.com/iccatalog

Industry Mall (Online ordering system)


https://mall.industry.siemens.com/mall/en/us/Catalog/product?mlfb=US2:18HUG82WJ


Service&Support (Manuals, Certificates, Characteristics, FAQs,...) https://support.industry.siemens.com/cs/US/en/ps/US2:18HUG82WJ

Image database (product images, 2D dimension drawings, 3D models, device circuit diagrams, EPLAN macros, ...) http://www.automation.siemens.com/bilddb/cax_de.aspx?mlfb=US2:18HUG82WJ&lang=en

Certificates/approvals

https://support.industry.siemens.com/cs/US/en/ps/US2:18HUG82WJ/certificate

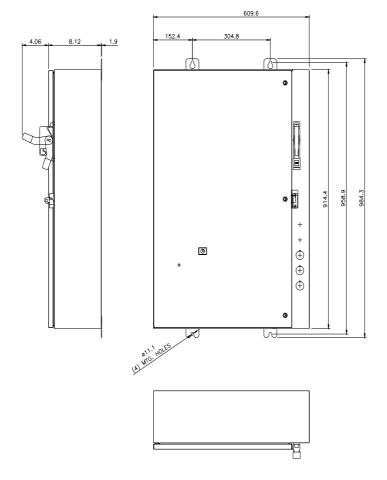

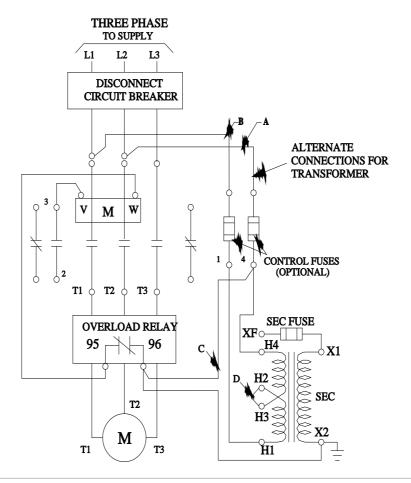

last modified: 1/25/2022 🖸