## SIEMENS

## Data sheet

## US2:18HUG82XL



Non-reversing motor starter, Size 3, Three phase full voltage, Solid-state overload relay, OLR amp range 25-100A, 240V 50Hz / 277V 60Hz coil, Combination type, 125A circuit breaker, Encl NEMA type 4X 316 S-Steel, Water/dust tight noncorrosive, Extra-wide enclosure

product brand name	Class 18 & 26
design of the product	Full-voltage non-reversing motor starter with motor circuit protector
special product feature	ESP200 overload relay
General technical data	
Height x Width x Depth [in]	36 × 24 × 8 in
touch protection against electrical shock	NA for enclosed products
installation altitude [ft] at height above sea level maximum	6560 ft
ambient temperature [°F]	
during storage	-22 +149 °F
during operation	-4 +104 °F
ambient temperature	
during storage	-30 +65 °C
during operation	-20 +40 °C
Horsepower ratings	
yielded mechanical performance [hp] for 3-phase AC motor	
• at 200/208 V rated value	25 hp
• at 220/230 V rated value	30 hp
• at 460/480 V rated value	50 hp
• at 575/600 V rated value	50 hp
Contactor	
size of contactor	NEMA controller size 3
number of NO contacts for main contacts	3
operating voltage for main current circuit at AC at 60 Hz maximum	600 V
operational current at AC at 600 V rated value	90 A
mechanical service life (operating cycles) of the main contacts typical	500000
Auxiliary contact	
number of NC contacts at contactor for auxiliary contacts	0
number of NO contacts at contactor for auxiliary contacts	1
number of total auxiliary contacts maximum	7
contact rating of auxiliary contacts of contactor according to UL	10A@600VAC (A600), 5A@600VDC (P600)
Coil	
type of voltage of the control supply voltage	AC
control supply voltage	
• at AC at 50 Hz rated value	240 V
<ul> <li>at AC at 60 Hz rated value</li> </ul>	277 V
holding power at AC minimum	14 W
apparent pick-up power of magnet coil at AC	310 VA
apparent holding power of magnet coil at AC	26 VA
operating range factor control supply voltage rated value of	0.85 1.1

magnet coil	50 %
percental drop-out voltage of magnet coil related to the input voltage	00 /0
ON-delay time	26 41 ms
OFF-delay time	14 19 ms
Overload relay	
reset function	Manual, automatic and remote
trip class	CLASS 5 / 10 / 20 (factory set) / 30
adjustable current response value current of the current- dependent overload release	25 100 A
make time with automatic start after power failure maximum	3 s
relative repeat accuracy	1 %
number of NC contacts of auxiliary contacts of overload relay	1
number of NO contacts of auxiliary contacts of overload relay	1
operational current of auxiliary contacts of overload relay	
• at AC at 600 V	5 A
• at DC at 250 V	1 A
contact rating of auxiliary contacts of overload relay according to UL	5A@600VAC (B600), 1A@250VDC (R300)
insulation voltage (Ui)	0001/
with single-phase operation at AC rated value	600 V
with multi-phase operation at AC rated value	300 V
Enclosure	
degree of protection NEMA rating	4X, 304 stainless steel
design of the housing	dustproof, waterproof & resistant to corrosion
Circuit Breaker	
type of the motor protection	Motor circuit protector (magnetic trip only)
operational current of motor circuit breaker rated value	125 A
adjustable current response value current of instantaneous short-circuit trip unit	500 1250 A
Mounting/wiring	
mounting position	Vertical
mounting position fastening method	Surface mounting and installation
mounting position fastening method type of electrical connection for supply voltage line-side	Surface mounting and installation Box lug
mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG)
mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C
mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU
mounting position         fastening method         type of electrical connection for supply voltage line-side         type of connectable conductor cross-sections at line-side for         AWG cables single or multi-stranded         temperature of the conductor for supply maximum permissible         material of the conductor for supply         type of electrical connection for load-side outgoing feeder	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug
mounting position         fastening method         type of electrical connection for supply voltage line-side         type of connectable conductor cross-sections at line-side for         AWG cables single or multi-stranded         temperature of the conductor for supply maximum permissible         material of the conductor for supply         type of electrical connection for load-side outgoing feeder         tightening torque [lbf-in] for load-side outgoing feeder	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in
mounting position         fastening method         type of electrical connection for supply voltage line-side         type of connectable conductor cross-sections at line-side for         AWG cables single or multi-stranded         temperature of the conductor for supply maximum permissible         material of the conductor for supply         type of electrical connection for load-side outgoing feeder         tightening torque [lbf-in] for load-side outgoing feeder         type of connectable conductor cross-sections for AWG cables         for load-side outgoing feeder single or multi-stranded	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf·in 1x (14 2/0 AWG)
mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf·in 1x (14 2/0 AWG) 75 °C
mounting position         fastening method         type of electrical connection for supply voltage line-side         type of connectable conductor cross-sections at line-side for         AWG cables single or multi-stranded         temperature of the conductor for supply maximum permissible         material of the conductor for supply         type of electrical connection for load-side outgoing feeder         tightening torque [lbf-in] for load-side outgoing feeder         type of connectable conductor cross-sections for AWG cables         for load-side outgoing feeder single or multi-stranded         temperature of the conductor for load-side outgoing feeder         maximum permissible         material of the conductor for load-side outgoing feeder	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU
mounting position         fastening method         type of electrical connection for supply voltage line-side         type of connectable conductor cross-sections at line-side for         AWG cables single or multi-stranded         temperature of the conductor for supply maximum permissible         material of the conductor for supply         type of electrical connection for load-side outgoing feeder         tightening torque [lbf-in] for load-side outgoing feeder         type of connectable conductor cross-sections for AWG cables         for load-side outgoing feeder single or multi-stranded         temperature of the conductor for load-side outgoing feeder         type of connectable conductor for load-side outgoing feeder         type of connectable conductor for load-side outgoing feeder         material of the conductor for load-side outgoing feeder         maximum permissible         material of the conductor for load-side outgoing feeder         type of electrical connection of magnet coil	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals
mounting position         fastening method         type of electrical connection for supply voltage line-side         type of connectable conductor cross-sections at line-side for         AWG cables single or multi-stranded         temperature of the conductor for supply maximum permissible         material of the conductor for supply         type of electrical connection for load-side outgoing feeder         tightening torque [lbf-in] for load-side outgoing feeder         type of connectable conductor cross-sections for AWG cables         for load-side outgoing feeder single or multi-stranded         temperature of the conductor for load-side outgoing feeder         type of cleatrical connection for load-side outgoing feeder         type of connectable conductor cross-sections for AWG cables         for load-side outgoing feeder single or multi-stranded         temperature of the conductor for load-side outgoing feeder         maximum permissible         material of the conductor for load-side outgoing feeder         type of electrical connection of magnet coil         tightening torque [lbf-in] at magnet coil         type of connectable conductor cross-sections of magnet coil for	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU
mounting position         fastening method         type of electrical connection for supply voltage line-side         type of connectable conductor cross-sections at line-side for         AWG cables single or multi-stranded         temperature of the conductor for supply maximum permissible         material of the conductor for supply         type of electrical connection for load-side outgoing feeder         tightening torque [lbf-in] for load-side outgoing feeder         type of connectable conductor cross-sections for AWG cables         for load-side outgoing feeder         type of connectable conductor for load-side outgoing feeder         type of connectable conductor for load-side outgoing feeder         type of load-side outgoing feeder single or multi-stranded         temperature of the conductor for load-side outgoing feeder         maximum permissible         material of the conductor for load-side outgoing feeder         type of electrical connection of magnet coil         tightening torque [lbf-in] at magnet coil         type of connectable conductor cross-sections of magnet coil for         AWG cables single or multi-stranded         temperature of the conductor at magnet coil maximum	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf-in
mounting position         fastening method         type of electrical connection for supply voltage line-side         type of connectable conductor cross-sections at line-side for         AWG cables single or multi-stranded         temperature of the conductor for supply maximum permissible         material of the conductor for supply         type of electrical connection for load-side outgoing feeder         tightening torque [lbf-in] for load-side outgoing feeder         type of connectable conductor cross-sections for AWG cables         for load-side outgoing feeder single or multi-stranded         temperature of the conductor for load-side outgoing feeder         material of the conductor for load-side outgoing feeder         maximum permissible         material of the conductor for load-side outgoing feeder         type of electrical connection of magnet coil         tightening torque [lbf-in] at magnet coil         type of connectable conductor cross-sections of magnet coil for         AWG cables single or multi-stranded         temperature of the conductor at magnet coil maximum         permissible	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG) 75 °C
mounting position         fastening method         type of electrical connection for supply voltage line-side         type of connectable conductor cross-sections at line-side for         AWG cables single or multi-stranded         temperature of the conductor for supply maximum permissible         material of the conductor for supply         type of electrical connection for load-side outgoing feeder         tightening torque [lbf-in] for load-side outgoing feeder         type of connectable conductor cross-sections for AWG cables         for load-side outgoing feeder single or multi-stranded         temperature of the conductor for load-side outgoing feeder         maximum permissible         material of the conductor for load-side outgoing feeder         type of electrical connection of magnet coil         tightening torque [lbf-in] at magnet coil         type of connectable conductor cross-sections of magnet coil for         AWG cables single or multi-stranded         temperature of the conductor at magnet coil maximum         permissible	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf·in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf·in 2x (16 12 AWG) 75 °C
mounting position         fastening method         type of electrical connection for supply voltage line-side         type of connectable conductor cross-sections at line-side for         AWG cables single or multi-stranded         temperature of the conductor for supply maximum permissible         material of the conductor for supply         type of electrical connection for load-side outgoing feeder         tightening torque [lbf·in] for load-side outgoing feeder         type of connectable conductor rorss-sections for AWG cables         for load-side outgoing feeder single or multi-stranded         temperature of the conductor for load-side outgoing feeder         maximum permissible         material of the conductor for load-side outgoing feeder         type of electrical connection of magnet coil         tightening torque [lbf·in] at magnet coil         type of connectable conductor cross-sections of magnet coil for         AWG cables single or multi-stranded         temperature of the conductor at magnet coil maximum         permissible         material of the conductor at magnet coil         type of electrical connection of ro auxiliary contacts	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf·in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf·in 2x (16 12 AWG) 75 °C CU Screw-type terminals
mounting position         fastening method         type of electrical connection for supply voltage line-side         type of connectable conductor cross-sections at line-side for         AWG cables single or multi-stranded         temperature of the conductor for supply maximum permissible         material of the conductor for supply         type of electrical connection for load-side outgoing feeder         tightening torque [lbf-in] for load-side outgoing feeder         type of connectable conductor cross-sections for AWG cables         for load-side outgoing feeder single or multi-stranded         temperature of the conductor for load-side outgoing feeder         maximum permissible         material of the conductor for load-side outgoing feeder         maximum permissible         material of the conductor for load-side outgoing feeder         type of electrical connection of magnet coil         tightening torque [lbf-in] at magnet coil         type of connectable conductor cross-sections of magnet coil for         AWG cables single or multi-stranded         temperature of the conductor at magnet coil maximum         permissible         material of the conductor at magnet coil         type of electrical connection for auxiliary contacts         tightening torque [lbf-in] at contactor for auxiliary contacts         type of electrical connec	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf·in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf·in 2x (16 12 AWG) 75 °C
mounting position         fastening method         type of electrical connection for supply voltage line-side         type of connectable conductor cross-sections at line-side for         AWG cables single or multi-stranded         temperature of the conductor for supply maximum permissible         material of the conductor for supply         type of electrical connection for load-side outgoing feeder         tightening torque [lbf-in] for load-side outgoing feeder         type of connectable conductor cross-sections for AWG cables         for load-side outgoing feeder single or multi-stranded         temperature of the conductor for load-side outgoing feeder         maximum permissible         material of the conductor for load-side outgoing feeder         type of electrical connection of magnet coil         tightening torque [lbf-in] at magnet coil         type of connectable conductor at magnet coil maximum         permissible         material of the conductor at magnet coil         type of electrical connection for auxiliary contacts         tightening torque [lbf-in] at contactor for auxiliary contacts         type of electrical connection for auxiliary contacts <tr< td=""><td>Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG) 75 °C CU Screw-type terminals 10 15 lbf-in</td></tr<>	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG) 75 °C CU Screw-type terminals 10 15 lbf-in
mounting position         fastening method         type of electrical connection for supply voltage line-side         type of connectable conductor cross-sections at line-side for         AWG cables single or multi-stranded         temperature of the conductor for supply maximum permissible         material of the conductor for supply         type of electrical connection for load-side outgoing feeder         tightening torque [lbf-in] for load-side outgoing feeder         type of connectable conductor cross-sections for AWG cables         for load-side outgoing feeder single or multi-stranded         temperature of the conductor for load-side outgoing feeder         maximum permissible         material of the conductor for load-side outgoing feeder         type of electrical connection of magnet coil         tightening torque [lbf-in] at magnet coil         tightening torque [lbf-in] at magnet coil         type of cables single or multi-stranded         temperature of the conductor at magnet coil maximum         permissible         material of the conductor at magnet coil         tightening torque [lbf-in] at contactor for auxiliary contacts	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf·in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf·in 2x (16 12 AWG) 75 °C CU Screw-type terminals 10 15 lbf·in 1x (12 AWG), 2x (16 14 AWG), 2x (18 16 AWG)
mounting position         fastening method         type of electrical connection for supply voltage line-side         type of connectable conductor cross-sections at line-side for         AWG cables single or multi-stranded         temperature of the conductor for supply maximum permissible         material of the conductor for supply         type of electrical connection for load-side outgoing feeder         tightening torque [lbf-in] for load-side outgoing feeder         type of connectable conductor cross-sections for AWG cables         for load-side outgoing feeder single or multi-stranded         temperature of the conductor for load-side outgoing feeder         maximum permissible         material of the conductor for load-side outgoing feeder         type of electrical connection of magnet coil         tightening torque [lbf-in] at magnet coil         type of connectable conductor at magnet coil maximum         permissible         material of the conductor at magnet coil         type of electrical connection for auxiliary contacts         tightening torque [lbf-in] at contactor for auxiliary contacts         type of electrical connection for auxiliary contacts <tr< td=""><td>Surface mounting and installation         Box lug         1x (10 AWG 1/0 AWG)         75 °C         AL or CU         Box lug         120 120 lbf-in         1x (14 2/0 AWG)         75 °C         AL or CU         Screw-type terminals         5 12 lbf-in         2x (16 12 AWG)         75 °C         CU         Screw-type terminals         10 12 AWG)         75 °C         CU         Screw-type terminals         10 12 AWG)         75 °C         CU         Screw-type terminals         10 15 lbf-in         1x (12 AWG), 2x (16 14 AWG), 2x (18 16 AWG)         75 °C</td></tr<>	Surface mounting and installation         Box lug         1x (10 AWG 1/0 AWG)         75 °C         AL or CU         Box lug         120 120 lbf-in         1x (14 2/0 AWG)         75 °C         AL or CU         Screw-type terminals         5 12 lbf-in         2x (16 12 AWG)         75 °C         CU         Screw-type terminals         10 12 AWG)         75 °C         CU         Screw-type terminals         10 12 AWG)         75 °C         CU         Screw-type terminals         10 15 lbf-in         1x (12 AWG), 2x (16 14 AWG), 2x (18 16 AWG)         75 °C
mounting positionfastening methodtype of electrical connection for supply voltage line-sidetype of connectable conductor cross-sections at line-side for AWG cables single or multi-strandedtemperature of the conductor for supply maximum permissiblematerial of the conductor for supplytype of electrical connection for load-side outgoing feedertightening torque [lbf-in] for load-side outgoing feedertype of connectable conductor for supplytype of connectable conductor for load-side outgoing feedertype of connectable conductor for load-side outgoing feedermaximum permissiblematerial of the conductor for load-side outgoing feedermaximum permissiblematerial of the conductor for load-side outgoing feedertype of electrical connection of magnet coiltightening torque [lbf-in] at magnet coiltype of connectable conductor at magnet coil maximum permissiblematerial of the conductor at magnet coil maximum permissiblematerial of the conductor at magnet coiltype of electrical connection for auxiliary contactstightening torque [lbf-in] at contactor for auxiliary contactstightening torque [lbf-in] at contactor for auxiliary contactstype of connectable conductor at magnet coiltype of connectable conductor cross-sections at contactor for AWG cables for auxiliary contactstype of electrical connection for auxiliary contactstype of electrical connection for auxiliary contactstype of connectable conductor at contactor for auxiliary contactstype of electrical connection for auxiliary contactstyp	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG) 75 °C CU Screw-type terminals 10 15 lbf-in 1x (12 AWG), 2x (16 14 AWG), 2x (18 16 AWG) 75 °C CU
mounting position         fastening method         type of electrical connection for supply voltage line-side         type of connectable conductor cross-sections at line-side for         AWG cables single or multi-stranded         temperature of the conductor for supply maximum permissible         material of the conductor for supply         type of electrical connection for load-side outgoing feeder         tightening torque [lbf-in] for load-side outgoing feeder         type of connectable conductor cross-sections for AWG cables         for load-side outgoing feeder single or multi-stranded         temperature of the conductor for load-side outgoing feeder         maximum permissible         material of the conductor for load-side outgoing feeder         type of electrical connection of magnet coil         type of connectable conductor cross-sections of magnet coil for         AWG cables single or multi-stranded         temperature of the conductor at magnet coil         type of connectable conductor at magnet coil maximum         permissible         material of the conductor at magnet coil         type of electrical connection for auxiliary contacts         tightening torque [lbf-in] at contactor for auxiliary contacts         type of electrical connection for auxiliary contacts         type of connectable conductor cross-sections at contactor for	Surface mounting and installation Box lug 1x (10 AWG 1/0 AWG) 75 °C AL or CU Box lug 120 120 lbf-in 1x (14 2/0 AWG) 75 °C AL or CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG) 75 °C CU Screw-type terminals 10 15 lbf-in 1x (12 AWG), 2x (16 14 AWG), 2x (18 16 AWG) 75 °C CU Screw-type terminals

75 °C
CU
Instantaneous trip circuit breaker
100 kA
100 kA
25 kA
NEMA ICS 2; UL 508; CSA 22.2, No.14

Further information

Industrial Controls - Product Overview (Catalogs, Brochures,...)

www.usa.siemens.com/iccatalog

Industry Mall (Online ordering system)


https://mall.industry.siemens.com/mall/en/us/Catalog/product?mlfb=US2:18HUG82XL


Service&Support (Manuals, Certificates, Characteristics, FAQs,...) https://support.industry.siemens.com/cs/US/en/ps/US2:18HUG82XL

Image database (product images, 2D dimension drawings, 3D models, device circuit diagrams, EPLAN macros, ...) http://www.automation.siemens.com/bilddb/cax\_de.aspx?mlfb=US2:18HUG82XL&lang=en

Certificates/approvals

https://support.industry.siemens.com/cs/US/en/ps/US2:18HUG82XL/certificate

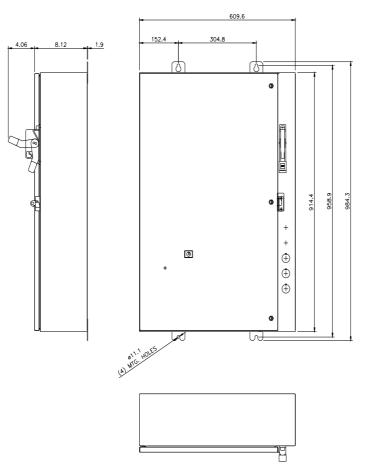

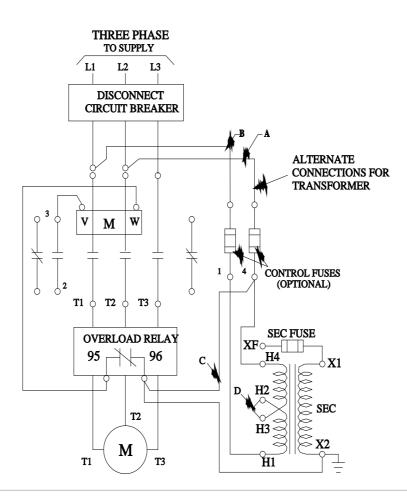

last modified:

1/25/2022 🖸